



## 8500 Field Cultivator Update Fold Bracket Update

### General Information

These Instructions explain how to install the fold bracket kit update. These instructions apply to kit number: 560-

534A 8500 FC FOLD BRACKET SUPPORT KIT. The kit will include 4 sets of brackets.

### Tools Required

- Basic Hand Tools

- Torque Wrench
- Basic Hand Tools

### Manual Update

Refer to the Field Cultivator operator's manual for detailed safety and maintaining of machine. Refer to parts manual for part identification.

560-484M Operator Manual

560-484P Parts Manual

### 560-534A Kit

Part Number	Description	Qty.
560-533H	8500 FC FOLD BRACKET SUPPORT	4
803-020C	NUT HEX 1/2-13 PLT	16
803-021C	NUT HEX 5/8-11 PLT	8
804-015C	WASHER LOCK SPRING 1/2 PLT	16
804-022C	WASHER LOCK SPRING 5/8 PLT	8
806-079C	U-BOLT 5/8-11 X 3 1/32 X 5 1/2	4
806-092C	U-BOLT 1/2-13 X 2 X 4	8

## Install 5-Section Wing Fold

Move machine to level ground and unfold wings. Align 560-533H bracket ① with 4 hole angled plate to bottom side of Position 560-533H bracket ①. Bracket should

### Refer to Figure 1

1. Position 560-533H bracket ① between wing frame tube and fold bracket ② (angled plate same angle as fold bracket).
2. Slide 806-079C u-bolt ③ over wing frame tube from bottom and through holes of plate on bottom of bracket ②, secure with 5/8 lock washers and 5/8 nuts.
3. Slide two 806-092C u-bolts ④ over top side of fold bracket ② and through holes of plate on top of bracket ①, secure with 1/2 lock washers and 1/2 nuts.
4. Tighten all u-bolts and repeat same procedure for all four fold brackets.

slide from inside of machine until snug between wing frame tube and fold bracket.

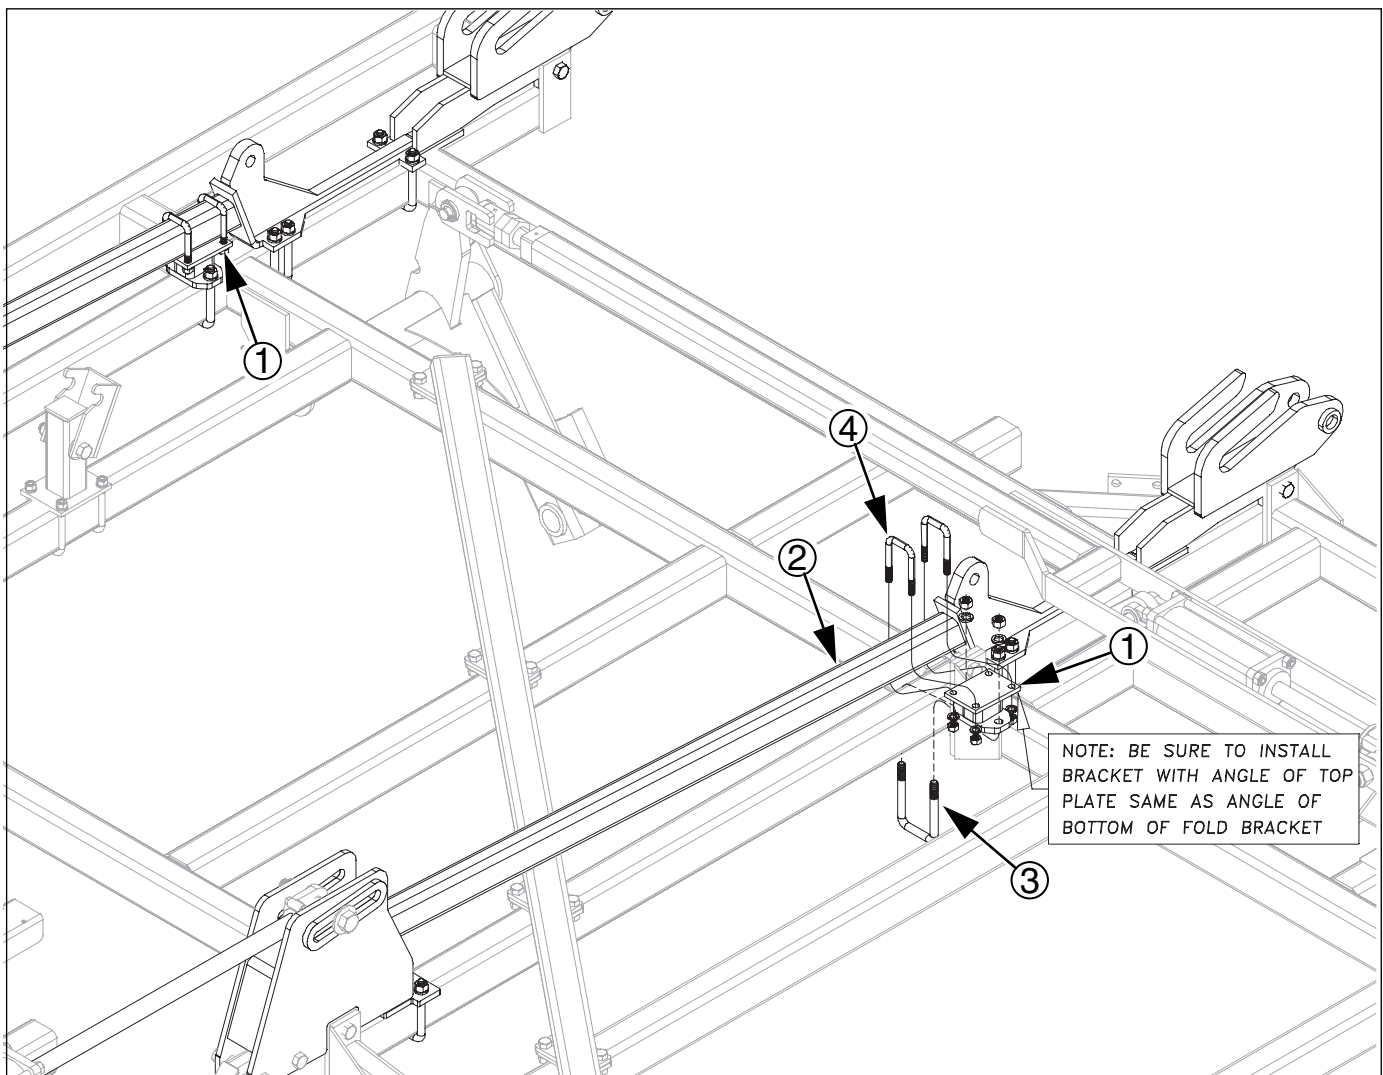


Figure 1  
Bracket Assembly

42159